ORACLE LIGHTING

GEN 3 CAMARO TAIL LIGHTS
ORACLE PART #8210-023
INSTALLATION GUIDE

TOOLS NEEDED:
T-15 TORX
PANEL TOOL
HEAT GUN
PLIERS

SCAN TO VIEW INSTALL VIDEO

Estimated Install Time: 60-90 Minutes
Difficulty: Intermediate

1 Before touching any electrical components, disconnect the negative battery terminal. Remove the (5) Twist Nuts to remove the tail lights from the vehicle.

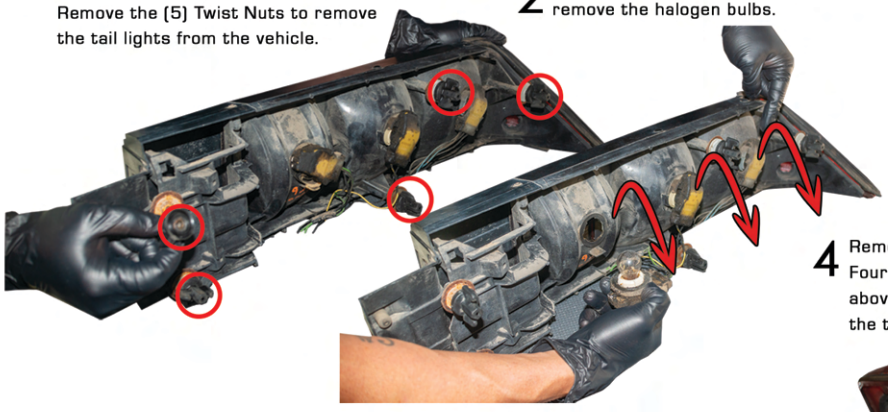

2 Twist off the halogen stock bulb sockets and remove the halogen bulbs.

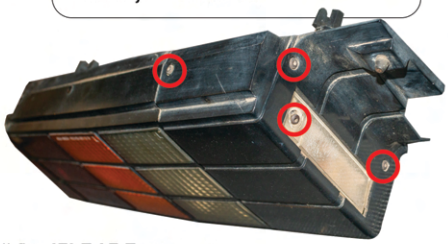

3 Before heating, remove the two retaining clips on the top of the tail light. Use a pair of pliers to pinch the edges of the clips on the underside of the tail light.

4 Remove all five (5) T-15 Torx screws. Four are located in the positions shown above and one is located on the bottom of the tail light.

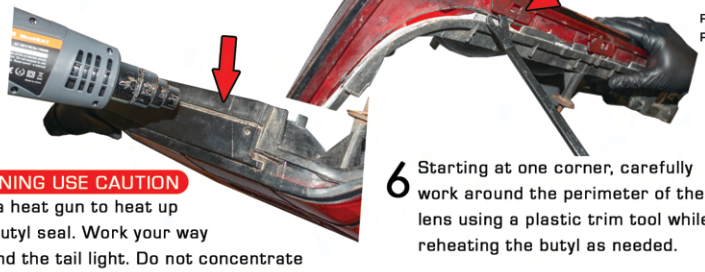

5

WARNING USE CAUTION

Use a heat gun to heat up the butyl seal. Work your way around the tail light. Do not concentrate heat in one area. Keep the heat gun moving. Excessive heat may warp the housing or lens.

6 Starting at one corner, carefully work around the perimeter of the lens using a plastic trim tool while reheating the butyl as needed.

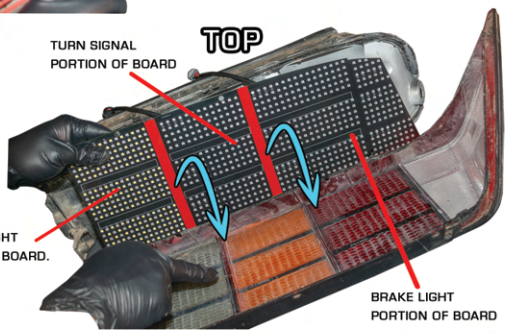

PASSENGER SIDE TAIL LIGHT SHOWN.

7 Once the lens is separated, line up the board in this orientation. Remove the 3m Tape Backing. Press firmly, ensuring the adhesive aligns with the edges marked by the arrows.

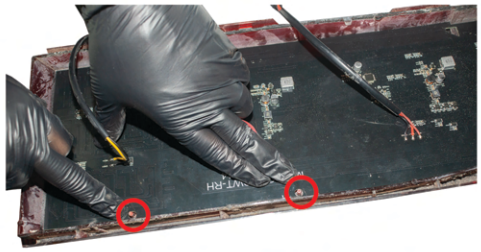

8 Position the LED board over the factory mounting posts. Ensure both mounting holes fully seat onto the posts and the edge of the PCB aligns with the reflector corner shown.

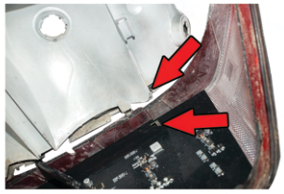

9 Feed the wires through the factory openings shown and ensure they will not be pinched during reassembly.

11 Connect the new board connectors to the OEM bulb sockets and test all lighting functions before reinstalling the tail light.

TEST ALL FUNCTIONS BEFORE RESEALING THE LENS.

10 Begin reassembling the tail light following the steps 3-5 in reverse order. Ensure lens is fully seated around entire perimeter. Verify butyl seal is continuous. Reheat and apply pressure if necessary.

© 2026 ORACLE LIGHTING
4401 Division St.
Metairie, LA 70002

FOR ADDITIONAL TECHNICAL SUPPORT PLEASE CALL US 1(800)407-5776